Important: To upgrade from Quantum HD version 10.21 or earlier to Quantum HD Unity version 10.30 or later requires the flashcard to be changed. These are available through the Baltimore Parts Center, part number 649A1131Gxx.

Common Release Notes Q5 11.01 / Q6 12.01

COMPRESSOR

GEA GM Package

• The GEA GM package control was updated to better unload the slide valve when the compressor is Off. For a GEA GM package with no oil pump, if the compressor is Off, the Capacity Mode is in Auto and the Slide Valve Position is above 5%, the Slide Valve Load and Unload outputs are energized at the same time. After the Slide Valve Position drops below 5%, both outputs will turn off. These outputs are energized to equalize the pressure on either side of the slide valve piston allowing the internal spring in the compressor to unload the Slide Valve.

Automatic Capacity Mode – Minimum Slide Valve Position

• Fixed an issue where a compressor was unable to unload to 0% while the Capacity Mode was Auto or the Sequencing feature was being used. The compressor was not able to unload to 0% due to a hidden minimum slide valve setting which has been removed.

Pull Down Feature

With an RDB package, the "Force Unload Load Inhibit" timer to be turned off on startup
if the Pull Down feature is enabled to prevent the two Load Inhibits from being in
conflict

Capacity Control Display

- Fixed an issue where the current capacity control mode was not being updated on the banner at the top of the screen
- Enhanced the Capacity Control page to include the title and description of the current mode being modified

Serial Communications

- Fixed an issue where the bad packet counter was not being incremented when DBS or SSW communication was configured
- Fixed an issue where having multiple serial port communication protocols enabled was generating a condition that caused random bursts of data to be periodically transmitted on the activated ports.

User Defined Refrigerants

- Updated the user defined refrigerant selections to include the most recent language data.
- Fixed an issue where certain user defined refrigerant selections were displaying the incorrect text

Event Log

 Fixed an issue where the event log was not showing the proper text readout causing incorrect language data to be displayed

Analog I/O Modal

• Fixed an issue where selectable values in the modals on the Analog I/O configuration page were being displayed off the screen

Trending

- Enhanced the Trending feature to allow a user to select up to 10 channels for both Historical and Real Time Trending
- Updated the file downloaded from the Trending pages to now indicate in the file name if the data is Historical or Real Time Trending data

Contacts

 Enhanced the Contacts page to now be shared and distributed to other Unity Compressor product panels

Pressure Resolution

 Moved the "Pressure Resolution" setpoint to the panel page and changed the value to be shared and distributed between other Unity Compressor product panels

Analog Outputs

Added the option on the Analog Output page to change the Sensor Output to 0-10v

Network Factory Settings

 Enhanced the process of restoring network settings to default by using the (Q6) dipswitch/ (Q5) jumper configuration to clear and rewrite all network settings to avoid potential sync issues

Email Notifications

- Enhanced the notifications email server to reliably send new events and alarms on a one minute cycle as new events and alarms occur
- Combined the email notifications and group pages into one page to simplify managing notification configurations

Clean Screen Timeout

- Changed the default timer for the Clean Screen feature from 1 minute to 30 seconds
- Changed the units for the Clean Screen timer to be seconds rather than minutes

Setpoint Maintenance

 Updated the feedback message that informs the user that invalid characters were entered when trying to save a setpoint file to be more specific and contain all of the characters considered illegal by the controller

URL Field

Removed the URL field from the Edit page in the product list

Advanced Network Settings

- Added an "Advanced Network" dropdown located on the Network page which will hide or display advanced networking configurations
- Added the option to configure the Dynamic Name Server used by the panel. This option is located on the Networking page from the System Overview after setting Advanced Networking to be "Displayed"

Delete Saved Setpoints

• Enhanced the "Delete Setpoints" operation to no longer require the server to be restarted.

Touchscreen Calibration

 Added a modal to be displayed after the user performs a touchscreen calibration indicating the result of the calibration. If calibration fails for any reason, the user will be prompted to retry

Email - SMTP Factory Settings #2

 Fixed an authorization mismatch that was causing emails and notifications using the Factory Settings #2 option to fail to send

Email – SMTP Password

• Added a mask to the SMTP password field that will hide the plain-text saved passwords.

Panel Time

- Removed an automatic service that was causing the panel time to be reverted after rebooting while connected to a network with internet access
- Added a dropdown for the user to select a time zone
- Changing the date format from US to European format will not update the date fields on the screen to be shown in the correct order

Add Factory Card Page

 Fixed an issue where a user was not able to open the System Overview menu modal while accessing the Add Factory Card page

Panel Temperature Selection

 Fixed an issue where changing the temperature units was not distributed to all products within the Quantum HD Unity Network

About Screen

 Changed the size of the CFast/CompactFlash card id column so the text would not wrap to the next row

Network Restore

 Fixed an issue that prevented the changing of network settings after performing a network restore via the (Q6) dipswitch/ (Q5) jumper

Security Users

- Fixed an issue where attempting to delete the currently logged in user would log out prematurely and cause the operation to fail
- Implemented a feature that automatically logs a User out if they choose to restore default users while not being logged in as one of those groups

Remote Users Page

 Fixed an issue on the Remote Users page where expired sessions were not being removed from the Sessions List

500 Error Page

• Updated the 500 error page to allow a user to redirect in the rare case of an internal server error rather than be forced to reboot the panel

Freeze Screen Update

- Updated the Alarms page to now have a "Freeze Data" button that will display a modal with the data values captured when the alarm occurred.
- Enhanced the Freeze Screen modal to show more data and corrected instances where the wrong text index was being displayed

Compressor Release Notes Q5 11.00 / Q6 12.00

Compressor

Networked Product Message

• Changed the Network List page to update the message requiring all Unity products to be version 10.40 or later.

Sequencing Control

- Added a "Full Load Drive Speed" setpoint on the Sequencing Control page. (PUC-344)
- Fixed an issue where the Sequencing Master Compressor was not identified on the Sequencing page.

Trending – Est. kW

• Added "Estimated kW" as a Trending option that defaults to a calculated kW value when an analog input for kW is not configured.

Capacity Slide Position

• Fixed an issue where the Capacity Slide Position on various pages was being incorrectly displayed as an analog value instead of a calculated value.

Skip Frequency Bands

- Fixed an issue where a user was able to enter overlapping Skip Frequencies on the VSD configuration page.
- Added a warning message when a user tries to set a Skip Frequency Band range greater than 5% while preventing a range greater than 20%.

Remote Capacity Control

• Fixed an issue where the value of the Remote Capacity Control setpoint was not matching on different pages.

IP Address Range

 Fixed an issue that allowed a user to enter an invalid IP address and port number which would cause the panel to lose connection with other Unity products.

Setpoint Maintenance

- Fixed an issue where a large saved setpoint filename would cause the submit button on the Restore Setpoint page to be pushed off the screen.
- Fixed an issue where entering invalid characters while saving setpoints caused the save to fail.

IP Address Range

• Fixed an issue that allowed a user to enter an invalid IP address and port number which would cause the panel to lose connection with other Unity products.

Security Users

- Fixed an issue where one of the default user levels could be removed.
- Fixed an issue where a Security User could be set up without specifying a PIN code.
- Fixed an issue where editing a Security User caused the associated PIN code to be lost.

Network Configuration

• Fixed an issue where entering invalid network configurations would cause the panel to malfunction due to the operating system not recognizing the network interface settings.

Unity Network

• Fixed an issue where a user could add multiple Condenser/Vessel and Engine Room products to the Unity network.

Compressor Overview

• Fixed an issue on the System Overview page where a Unity product in shutdown would incorrectly be shown as in a warning state.

Panel Temperature Selection

• Fixed an issue where changing the unit of temperature measurement was not reflected on other products within the Unity Network. Changing this value will now be correctly distributed to all connected products.

Number Entry

 Fixed an issue where a user accessing a Unity product remotely would have inconsistencies with the displayed keypad when clicking on a setpoint field in an unexpected way.

On-Screen Keyboard

- Fixed an issue with the onscreen keyboard where the behavior of Shift and Caps Lock was not consistent.
- Changed the onscreen keyboard Shift key to now toggle "off" after typing one character instead of remaining active.

Remote Users Page

 Added a Session List to the Security page that allows a user to see other users who are remotely logged in to the panel.

About Screen

- Added additional fields to the About page that shows the board type, distinguishing between Q5 and Q6 processors.
- Added range checking to the Order Number and Sales Number fields on the About screen to ensure that the numbers entered are valid.

Remote Auto Login

• Fixed an issue where Auto Login failed when the Unity Network contained more than one compressor.

Factory Menu

• Fixed an issue where the Menu and the Compressor Controller Buttons were overlapping while logged in at the Factory level.

Demo Mode

Fixed an issue where the language field was allowed to be changed on the demo panels.

Compressor Release Notes 10.53

Compressor

WEG Fix

 An issue was corrected where the following 8 alarms were not being checked when the Drive Type was set to SSW (Solid State WEG). Refer to Frick NS Letter NS-15-17 for more details

High Motor Current Shutdown
High Motor Current Warning
Low Motor Current Shutdown
Compressor Auxiliary Shutdown

Starting Failure – No Compressor Aux Starting Failure – Low Motor Amps

False Running Failure – Compressor Confirmed Running Input False Running Failure – Motor Amps

Digital I/O Settings

 On Page 4 of the Digital I/O Configuration, a number of the IO Board and IO Channel selections were displayed incorrectly. The selections did not match the Channel Names that were listed. In addition, some of the Status values were incorrect. These items have been corrected.

Condenser Control

 On the Condenser Configuration page, the Output B VFD speed was always displayed as 0% even when the Output B VFD was operating. This has been corrected to show the Output B VFD speed.

Compressor Release Notes 10.52

Compressor

Skip Frequency Bands

Added 3 skip frequency bands to the VSD page, increasing the total number of bands to
 8.

Restore Setpoints

- Fixed an issue where the restoration of setpoints caused the local panel to lose visibility of other Unity products.
- Fixed an issue where the restoration of setpoints would fail if the name given to the saved setpoints was too long.

GEA GM Package

Added the GEA GM package type as a standard selection.

Capacity Slide Position

 On the System Operating Values (Home Page) and on the User Defined Page, changed the Capacity Slide Position to show the calculated value instead of the Analog value. The Calculated value is the Capacity Slide value that is displayed on the Home page.

Maintenance Log

• Fixed an issue where messages submitted through the Maintenance Log were not being displayed on Maintenance Log page.

Messages

 Fixed an issue where submitted messages were being formatted to only display lowercase characters.

Email Notification

• Changed the email notification for events and alarms to now include the user defined name of the product in the email header.

Ping Command

• Changed the Ping Command function on the Diagnostics Page to now display the entered IP address and to execute the ping when the corresponding button is pressed.

Back Button

• Changed the Back Button style/color on the Retransmitting Output and Superheat Control pages to match the convention used elsewhere throughout the software.

IO Channel Entry

- Changed the setpoint entry box on the Analog Outputs page to display the name of the Analog Output when modifying an I/O Channel value.
- Changed the setpoint entry box on the Digital I/O page to display the name of the Output when modifying an I/O Channel value.

• Changed the setpoint entry box on the Retransmitting Output page to display the Row Letter when modifying an I/O Channel value.

Condenser Step Order

• Changed the Step Order setpoint entry boxes on the Condenser page to display the output that is being modified.

Compressor Sequencing System Pages

- Removed the "Order" button from the Sequencing System pages.
- Changed the setpoint entry on the Sequencing System pages to display the row letter of the sequencing setpoint that is being modified.
- Changed instances where "Control Point" was displayed on Sequencing pages to "Control Value" to adhere to a consistent nomenclature.

Timed Digital Output Control

• Changed the Time of Day setpoint entry boxes on the Digital Auxiliaries Page to display channel information for the field that is being modified.

Compressor Release Notes 10.51

Compressor

Economizer Control/WEG

• Fixed an issue where the economizer output would not turn on when the Drive Type was set to <u>SSW</u> (Solid State WEG starter).

WEG Starter Comms

- Fixed an issue where the motor amps would be displayed on the Quantum HD at 1/10th
 the actual amp draw. This only occurs under the following configuration/condition.
 - The Drive type is selected as "SSW" on the Package Configuration page.
 - The "Read Motor Amps From" parameter is selected as "SSW" on the SSW Starter page in Drive Configuration.
 - The starter size is 820 amp or higher.

On all other starters, the communicated amp draw displayed on the Quantum HD is correct.

Recip Compressor Control

- Added new features to the Recip package type. These include digital output control for Head Cooling, Oil Cooling and Separator Oil Return, VFD control for Recip compressors and updated oil safeties to match the requirements of Recip compressors.
- The Recip Starting logic was updated, allowing the Recip compressor to step load to 100% capacity immediately after starting. In previous versions there was a fixed delay after Starting before the Recip steps were allowed to load.

Economizer Digital Output Override Message

Added an "<u>Override</u>" message that is displayed when the differential pressure between
discharge and suction is too low. This message indicates why the economizer digital
output is not energized. The override message and logic are displayed in the Economizer
parameter block on the Package Configuration page.

Event Emails

• Fixed an issue where the message attached to a "Clear Recycle Delay" Event was blank.

Email Notification

• Fixed issue where the "Send Notification" button was not working with User Defined settings on the Notifications Screen.

Ethernet Port Blocking

 Added Ethernet ports "44818" (Allen Bradley Ethernet/IP) and "502" (Modbus TCP) to the list of blocked ports.

RDB Compressor Setpoints

 Fixed an issue with the RDB package type where the RDB setpoints on the Configuration > Compressor page were being displayed off the page when all the options were enabled.

Capacity / Volume Calibration Page

• Changed the heading on the upper left corner of the page to display "Capacity Slide".

RELEASE NOTES FOR 10.50

Compressor

Product Selection Banner

• Updated look and feel of product selection banner. Lowered product selection dropdown, updated dropdown text to "Product Selection" and made product name text display.

Slide Valve Load Inhibit and Force Unload Messages Not Displayed

• The Load Inhibit and Force Unload Messages are now displayed on the Home page when the panel is in a Load Inhibit or Force Unload condition.

Separator Heater Control

When the Oil Pump type is set to "Full Time" and Oil Level Shutdown is Enabled, the
 <u>Separator Heater</u> output is now turned "Off" when the Oil Level Input is not energized.

 This aligns with the logic for No Pump and Demand Pump.

Oil Level Safety

 The Oil Level Safety logic was updated to make sure that the Oil Level Safety is active if the package has an Oil Level Input. These Oil Level Safety changes now align with the Separator Heater changes.

Alarm Output

 Added a selection to allow the Alarm Output to be setup for "Energized" or "De-Energized" with an Alarm.

Portuguese (Brazilian) & Spanish Language

• Added Brazilian Portuguese & Spanish languages to the product.

Email

 Fixed several problems with the Email features. They did not always work in prior versions.

Watchdog Jumper Update

 When the watchdog jumper process is initiated to clear setpoints, all settings are returned to factory defaults.

Compressor Overview - No Comms Message

• If there was a loss of comms between compressors, the wrong error message would display on Compressor Overview page.

Product Scroll (System Networking)

• Allow page to scroll if there are more products than can be displayed on the screen.

Security/Users Scroll

 Added ability to scroll through users when there are more users than can be displayed on the page.

Software Upgrade Limitation

 Only allow upgrades to a newer version. Changing the program to a previous version is no longer allowed.

Enhance Saved Setpoints

• When setpoints are saved, the product name and software version are included within the folder name.

Language selection

Fixed issue where language selection would not be sent to all connected products.

Capacity Control Modes - Analog Aux inputs K-T

• For the Capacity Control Modes setup, the missing analog aux inputs K-T were added to the Control Input selection.

Filter Differential on Home Screen

• The filter differential value was removed on the home screen if the filter differential check option is set to disabled.

<u>Separator Temp – Recip compressor</u>

• The Separator Temp is removed from the Home screen if the Package Type is Recip and the Separator Temp input is Disabled (Analog Board selection is set to "None"). If the Package Type is not Recip, then the Separator Temp is always displayed on the Home page.

Setpoint Restoration

- Addressed issue where several values would not transfer correctly from legacy setpoints.
 - Process Leaving and Entering Temperature board & channel assignments.
 - Filter Pressure Diff Check.
 - Soft E-Stop Operation (touchscreen) when user is not logged in

Networking

• Fixed issue where networking would not be set correctly when restoring setpoints.

Trending Select Data

Made the Select Data lists for both Historical and Real Time Trending screens match.

Recycle Delay for VFD or Vyper Drive

• If the Drive Type is set to VFD or Vyper Drive and the Recycle Delay option is Enabled, the Recycle Delay Timer is now displayed on the Home screen.

Vilter Single Screw with Full Time Pump

Updated the Vilter Single Screw logic to operate properly with a Full Time Pump, usually
for a Booster Compressor. This includes changes to the pump logic and the oil safeties.
 With a Full Time Pump, the Demand Pump Stop CR and Demand Pump Restart CR
setpoints are hidden on the Vilter Setpoints screen.

Separator Velocity Reference Setpoint

Increased the Separator Velocity Reference Setpoint High Limit from 100 to 150.

Touchscreen Calibration

• Added Screen Calibration button to "System Configuration" menu.

Digital I/O – Page 5

• Added missing Digital I/O – Page 5.

RELEASE NOTES FOR 10.40

Compressor

Real Time Trending

• Fixed issue that caused a constant loading screen to appear in certain cases.

Home Page - Setpoint Button

• The Setpoint button now takes the user to the appropriate screen based on the current mode.

Bump Motor Unresponsive

• Fixed issue where the button Bump Motor was unresponsive.

Mapfile Enhancement

• The MapFile is now included when Setpoints are saved.

Stopping Enhancement

• To make an "Instant Stop" more obvious when stopping a machine manually, the "Instant Stop" selection was changed to state "E-Stop" and was made larger and colored RED size to make it an easier selection.

Historical Trending

• Changed wording from "Trending" to "Historical Trending".

Sequencing

Enhanced this page to make external keyboard navigation more user friendly.

Software Upgrade

Added message when no USB-Drive is detected.

Motor Amps/VFD

Fixed issue where the CT value was not showing up correctly in certain circumstances.

Alarms

 Addressed various issues with Freeze Screen including adding new Analog Values to select from.

Cross Product Communication

<u>Pressure Calibration – Pressure Resolution and Atmospheric Pressure</u>

- Added Atmospheric Pressure setting to all products
- The Pressure Display Resolution was added to handle special compressor applications. This was removed from other applications.

Sub-Navigation (Tabs)

• Sub-Navigation options are now a tab rather than just text.

Alarms – Clear Safety History

• Added confirmation of "Are you sure you want to clear the Safety History?" when clicking the Clear Safety History button.

Networking

- Added a "Add Factory Card" feature that allows you to commission a card on the Unity System where the Unity System's Gateway has been altered from the original settings.
- You can now successfully restore Setpoints on a panel where the Unity System's Gateway has been altered from the original settings.
- You can now successfully perform a system upgrade on a panel where the Unity System's Gateway has been altered from the original settings.

RELEASE NOTES FOR 10.31

Compressor

- Added the "Vyper Info" tab & screen that was missing in ver. 10.30 when a Vyper (RAM) is selected as the drive type
- Rearranged the layout of the Drive > Vyper > Cooling screen to capture all displayed values on the screen
- Corrected an issue where the IP address of the panel is corrupted when the IP address is reset to a
 default by connecting pins 7-8 jumper of the JP1 jumper on the comms interface board (the
 default is 192.168.0.170)
- Added spaces to the beginning of a wrapped line in a comms log files
- To properly capture analog data in the "System Data Download", the process for doing this was reverted back to the previous process where all analog input values (configured or not) are included in the created spreadsheet when a "System Data Download" is executed

RELEASE NOTES FOR 10.30

Compressor

- Transitioned Quantum HD compressor program to the "Unity" framework
- implemented the ability to communicate with the WEG SSW-06 and SSW-07 Soft-Starter devices
- Corrected an issue dealing with the conversion of Hg (negative) pressures when the Atmospheric Pressure was set to something other than 14.7 PSI
- Corrected an issue where the units were not being displayed correctly for the
- Setpoint and Actual data on the title bar when an Analog Aux input is selected as the capacity control input
- Changed code to set the output for the superheat control outputs to 0% when one is disabled
- Corrected an issue where upon power up the IP address would reset to 192.168.0.170 and the
 processor would reboot if a jumper is detected on JP1 pins 7 & 8 of the Communications Interface
 board.
- Corrected an issue where the IO integrity Check logic did no catch certain conflicts in I/O configuration